

**DEPARTMENT OF TRANSPORTATION****DIVISION OF ENGINEERING SERVICES**

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 1.28**WELDING INSPECTION REPORT****Resident Engineer:**Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-014682**Date Inspected:** 08-Jun-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 1000**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1830**Contractor:** American Bridge/Fluor Enterprises, a JV**Location:** Job Site

<b>CWI Name:</b>	Steven Mc Connell and Bonifacio			<b>CWI Present:</b>	<b>Yes</b>	<b>No</b>
<b>Inspected CWI report:</b>	<b>Yes</b>	<b>No</b>	<b>N/A</b>	<b>Rod Oven in Use:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Electrode to specification:</b>	<b>Yes</b>	<b>No</b>	<b>N/A</b>	<b>Weld Procedures Followed:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Qualified Welders:</b>	<b>Yes</b>	<b>No</b>	<b>N/A</b>	<b>Verified Joint Fit-up:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Approved Drawings:</b>	<b>Yes</b>	<b>No</b>	<b>N/A</b>	<b>Approved WPS:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
				<b>Delayed / Cancelled:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Bridge No:</b>	34-0006			<b>Component:</b>	Orthotropic Box Girder	

**Summary of Items Observed:**

Caltrans Office of Structural Material (OSM) Quality Assurance Inspector (QAI) Joselito Lizardo was present at the Self Anchored Suspension (SAS) job site as requested to perform observations on the welding of components for the San Francisco Oakland Bay Bridge (SFOBB) Project.

QA randomly observed ABF/JV qualified welders Rory Hogan (ID #3186) perform CJP groove (splice ) back welding fill pass on Orthotropic Box Girder (OBG) L2W/L3W side plate 'C1' outside. The welder was observed back welding in the 4G (overhead) position utilizing a dual shield Flux Cored Arc Welding (FCAW-G) with E71T-1M, 1/16" diameter wire electrode and implementing Caltrans approved Welding Procedure Specification (WPS) ABF-WPS-D15-3110-4. The welder was using a track mounted welder holder assembly that is remotely controlled. The joint being welded has the backing bar gouged using the Esab Plasma Arc machine and was ground smooth. The gouged and ground splice butt joint was also Non Destructive Testing (NDT) tested using the Magnetic Particle Testing (MT). The splice joint was preheated and maintained to greater than 200 degree Fahrenheit using Miller Proheat 35 Induction Heating System located at the other side of the plate prior/during welding. The vicinity was also properly protected from wind and other climatic conditions. ABF Quality Control (QC) William Sherwood was noted monitoring the welding parameters of the welder. During the shift, welding in this location was interrupted due to power supply failure. All major power supply lines on the west line were interrupted and welding was stopped except where diesel powered machine were used.

At OBG L2W/L3W edge plate 'F' outside, QA randomly observed welder Xiao Jian Wan welding the top and bottom run off tab on the splice butt joint. The welder was using FCAW-G in 2F and 4F positions. Prior to welding the run off tab, QA performed fit up/alignment verification on the joint and noted 2mm and less offset all


# WELDING INSPECTION REPORT

( Continued Page 2 of 3 )

throughout the joint which appears acceptable to the contract requirements. The welder also started late to work in this location due to the power supply interruption that occurred during the day. QA also noted QC Bernie Docena checking the welder's welding parameters prior welding.

At OBG L1E/L2E bottom plate 'D' inside, QA randomly observed ABF/JV qualified welder Fred Kaddu ID # 2188 perform CJP groove welding repair. The welder was observed welding in the 1G (flat) position utilizing Shielded metal Arc Welding (SMAW) with 1/8" diameter E7018H4R electrode implementing welding procedure ABF-WPS-D15-1000-Repairs. The repair excavations were preheated to more than 140 degree Fahrenheit using propane gas torch prior welding. During the shift, ABF QC Jesse Cayabyab was noted monitoring the welder. Prior welding, ABF QC Jesse Cayabyab was also observed performing Magnetic Particle Testing (MT) using Parker Contour Probe with red magnetic powder as detecting media on the repair excavation. There were no significant defects noted during the test. The welder has completed three welding repairs and was working on his 4th at the end of the shift.

At OBG L1E/L2E bottom plate 'D' outside, QA randomly observed ABF/JV qualified welder Mitch Sittinger ID #0315 perform CJP groove welding repair. The welder was observed welding in the 4G (overhead) position utilizing Shielded metal Arc Welding (SMAW) with 1/8" diameter E7018H4R electrode implementing welding procedure ABF-WPS-D15-1000-Repairs. The repair excavations were preheated to more than 140 degree Fahrenheit using propane gas torch prior welding. During the shift, ABF QC Jesse Cayabyab was noted monitoring the welder. Prior welding, ABF QC Jesse Cayabyab was also observed performing Magnetic Particle Testing (MT) using Parker Contour Probe with red magnetic powder as detecting media on the repair excavation. There were no significant defects noted during the test. During the shift, the welder has completed five repairs and was excavating the 6th welding repair at the end of the shift.

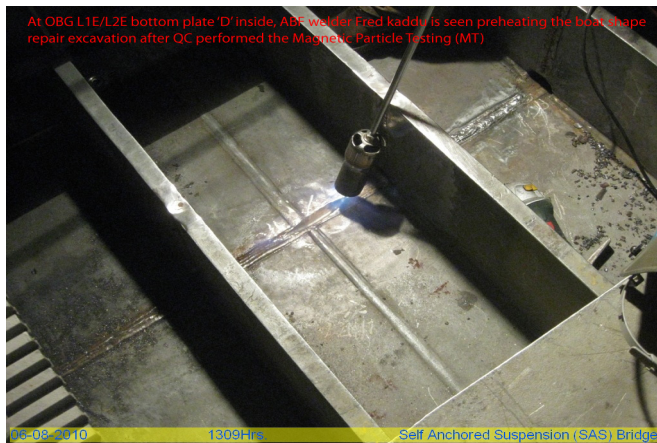

---

# WELDING INSPECTION REPORT

( Continued Page 3 of 3 )

---



## Summary of Conversations:

As stated above.

## Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact SMR Mohammad Fatemi (916) 227-5298, who represents the Office of Structural Materials for your project.

---

**Inspected By:** Lizardo, Joselito

Quality Assurance Inspector

---

**Reviewed By:** Levell, Bill

QA Reviewer